TYC/CLA. 2294819-506.508/ DHG NO. SINITLE COTA INLA NO. 2.2.2 22<u>94821</u><u>503</u> _. CATTICAL ITEMS LIST SHEET ŌΕ CRELICALITY FAILURE EFFECT FATTURE HOUE AND ON END ITEM RATIONALE FOR ACCEPTANCE CAUSE . DESIGN FEATURES (Continued) (I) Unable to open lens waltunction in the camera to cause otal loss of the active video sigiris. BARE BOARD DESIGN (A3, A4, A5, A6, A7, A9, A10, A12) (2) Degradation of pical or video information that will ture content. rovide degraded performance. Com-The design of the associated boards A3, A4, A5, A6, A7, A9, A10, A12 is constructed osite sync and vertical blanking from laminated copper-clad epoxy glass sheets (NEMA G-10) Grade FR-4), PER MIL-P-5561/A. Worst Case: iumals are useable and not affected. Circuit connections are made through printed traces which run from point to point on the Lass of mission. board surfaces. Every trace terminates at an annular ring. The annular ring critical video. surrounds the hole in which a component lead or terminal is located. This ring Command Decode Logic. provides a footing for the solder, ensuring good mechanical and electrical Command Execution Logic. performance. Its size and shape are governed by MIL-P-\$5640 as are trace widths, Camera liming logic. spacing and routing. These requirements are reiterated specifically in drawing 1 Horizontal Deflection. notes to further assure compliance. Variations between the artwork master and the Vertical Deflection. final product (sue to irregularities of the etching process) are also controlled by Focus Current. Horizontal Aligndrawing notes. This prevents making defective boards from good artwork. Holes which ment. Vertical Alignment. house no lead or terminal, but serve only to electrically interconnect the different Black/White Clipper. board layers, contain stitch bars for mechanical support and increased reliability. Gamma Correction. Aperture Correction. The thru holes are drilled from a drill tape thus eliminating the possibility of Shading Correction. buman error and allowing tight control over hole and annular ring concentricity, an Video Öutput Driver. important reliability criterian. After drilling and etching, All copper cladding is Automatic Light Controltin-lead plated per MIL-STD-1495. This provides for easy and reliable soldering at Automatic Gain Control. the time of board assembly, even after periods of prolonged storage. Dark Current Compensation. 6 Output Voltage Regulator, Input BOARD ASSEMBLY DESIGN (A3, A4, A5, A6, A7, A9, A12) Voltage Pre-Regulator. ? Primary Oscillator/ All components are installed in a manner which assures maximum reliability. Driver (sync loss) Component leads are pre-timed, allowing lotal wetting of solder joints. All leads Secondary Rectifiers/ Filters are formed to provide stress relief and the bodies of large components are staked. (change of voltage or loss of Special mounting and handling instructions are included in each drawing required filteringl after final assembly. The board is coated with unethane which protects against High Vultage Power Supply. humidity and contamination. Target Preamplifier. 10 Beam Current Regulator. fathode Blanking. 14 Shading Waveform Generator-14 \$11 luhe

2294819-506. 508/

3 DF 10

2294821-503

UNIT TVC/CLA SHUTTLE CCTV DMG NO. CRITICAL ETERS LIST SHEET CRITICALITY .__ 2/2 FAILURE EFFELT FAILURE MODE AND RATIONALE FOR ACCEPTANCE. ON END ITEM CAUSE DESIGN FEATURES (Continued) (1) Unable to open lens A mallonction in the camera to cause total loss of the active video sigiris. BARE BOARD CONSTRUCTION (A2) nal or video information that will 12) Degradation of pic-Lura content. provide degraded performance. Composite sync and vertical blanking signals are useable and not affected. Worst Case: Loss of mission critical video. A2 Cammand Decode Lagic. Command Execution togic. & construction techniques used in PC board layout apply. Camera liming togic. A3 Horizontal Deflection. Vartical Beflection. Focus Current, Harizantal Align-BOARD ASSEMBLY (A2) ment. Vertical Alignment. A4 Black/White Clipper. Gamma Currection. Aperture Correction. Shading Correction. Video Õulpul Driver. Ab Automatic Light Control. Automatic Gain Control. Wark Current Compensation. AL Output Voltage Regulator. Input Voltage Pre-Regulator. by drawing notes and the assembly is coated with orethane. Af Primary Oscillator/ Briver (sync luss) Secondary Rectifiers/ Fillers PC boards. tchange of voltage or luss of filtering) BOARD PLACEMENT AB High Voltage Power Supply. A9 target Preamplifier. Ald Beam Current Hegulator. Cathode Blanking. ALZ Shading Naveform Generator. A14 SIT Tube performance is assured.

The boards are of "welded wire" construction. At the bare board level this does not distinguish it from a normal PC board except that holes which will take weld pins generally are not connected to PC traces. Only those pins which bring power and ground potentials to the ICs are on PCs. An annular ring surrounds the hole in the board where each power and ground pin is located. These pins are then soldered to the trace like any other component lead. Aside from this feature, all design

The drilled and etched boards are populated with several hundred suiderable or weldable pins. Power and ground pins, as well as connector pins, are soldered in place. Discreet companents (resistors, diodes, capacitors) are attached to bifurcated terminals, where they are soldered. Flatpack ICs are welded, lead-by-lead to the tops of the weld pins. After welding, extra lead waterial is triumes away. Circuit connections are made using #30 AMG nickel weld wire. The wire is welfed to the pin surfaces on the board backside. All wire welds are done using a machine which is tape driven, thus eliminating the possibility of miswiring due to operator error. All wiring & circuit performance is tested prior to bux-level installation. After successful testing, components are staked as required

The board is inserted in the box on card-edge guides, in the same manner as the other

The A7-A low voltage power supply board is boilted in place at δ points around its perimeter. Four of these mounting screws also pass through and the down the smaller A7-8 board. These two boards are mounted face-to-face, separated by the standoffs. Electrical interconnections are achieved by jumper wires between the two boards. The A7-A houses a 34-pin connector which brings in power and signals from outside the module.

the A7 module includes these two boards as well as power transistor Q4. The module housing is bent aluminum sheet, comprised of two halves screwed together. The boards and 04 are secured to the lower half, and wired together. Then the upper half is put in place. By mounting Q4 directly to the aluminum housing, good thermal

The A2, A3, A4, A5, A6, A12 boards are secured in the electronics assembly by goldplated becyllium copper card quides. Cummections are made to the mother board with blind-maked connectors. Disengagement during launch is prevented by a cover which spans the buard's free edge.

5 60 - - C 47C

		-,	
THEA NO2,7.2		SHUTTLE CCTV CRITECAL ITEMS LIST	UNIT <u>IVC/CLA</u> OWG NO. <u>2294819-506, 508/</u> <u>2294821-503</u> SHEET <u>4</u> OF <u>10</u>
FAILURE MODE AND CAUSE Inalfunction in the camera to cause total loss of the active video signal or video information that will provide degraded performance. Composite sync and vertical blanking rignals are useable and not affected. Command Decode Logic. Command Execution togic. Command Execution. Vertical Oeflection. Vertical Oeflection. Vertical Alignment. Black/White Clipper. Comma Correction. Aperture Correction. Shading Correction. Video Output Driver. Automatic Light Control. Uark Current Compensation. Dutput Voltage Regulator. Input Voltage Regulator. Input Voltage Pre-Regulator. Primary Oscillator/ Driver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) Black Voltage Power Supply. Ingle Voltage Power Supply. Ingle Voltage Power Supply. Secondary Rectifier. Cathode Blanking. Stading Haveform Generator. SIT Tube	FAILURE EFFECT ON END ITEM (1) (Inable to open lens iris. (2) Degradation of picture content. Worst Case: Loss of mission critical video.	PESIGN FEATURES (Continued) Ato BDARO MOUNTING Due to packaging constraints within the camera, the in "cordwood" fashion. Two PC boards, each 2.1 incleach other, separated by 3/4 inch long standoffs. I distance between the boards and are soldered in planjumper wires are also mounted this way. All solder have a 1-inch diameter hole through the center. The this hole and has its flying leads soldered to thrucamera-level installation, the entire Alm module is stem, of the vidicum tube and bolted in four places then engaged manually to the tube, completing the in BDARO MOUNTING The A9 board is mounted to the target preamp housing provides ample support since the board is only 1.9 is correction is by jumper wires soldered to board ten is installed over the board to protect it during had larget preamp essembly. The high-voltage power supply is purchased to a peridetails the design, qualification, and production of Camera System. It is designed for a minimum operated shall exhibit no evidence of arcing, corona, or any failure when operated at any atmospheric pressure fall electronic components and materials used in the to conform with the reliability requirements of the by RASA-JSC.	Aid TVC divider assembly is Built hes square, are mounted opposite diaxial components span the se, one lead to each board. Some joints are staked. The boards widicon tube sorket fits through holes in one of the boards. At inserted in place around the to the housing. The sucket is installation. The boards of the boards of the housing of the sucket is installation. The boards of the boards of the stallation of the housing of the sucket is included and installation of the formance specification that spoint and installation of the formance specification that spoint in the second of the

			WEARDED 3-1-07
FMEA NO2.2.2		SHUTTLE CCTV CAITICAL ITEMS LIST	UNIT TVC/CLA THG NO. 2294819-506. 508/ 2294821-503 SHEET 5 OF 10.
FAILURE MODE AND FAILURE EFFECT		RATIONALE FOR ACCEPTANCE	
malfunction in the camera to cause tal loss of the active video siglor video information that will ovide degraded performance. Compate sync and vertical blanking gnals are useable and not affected. Command Decode Logic. Command Execution Logic. Command Execution Logic. Camera liming Logic. I Horizontal Beflection. Vertical Deflection. Focus Current. Horizontal Alignment. Vartical Alignment. Black/White Clipper. Gamma Correction. Shading Correction. Video Output Driver. Automatic Caln Control. Oark Current Compensation. Output Voltage Regulator. Input Voltage Pre-Regulator. Primary Oscillator/ Briver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) High Voltage Power Supply. Farget Preamplifier. Deam Current Regulator. Cathode Blanking. Shading Waveform Generator.	(1) Unable to open lans iris. (2) Degradation of picture content. Worst Case: Loss of mission critical video.	The SIT tube is a selected high-grade silicon-diode-are attached image intensifier for operating at low light is controlled by meaps of an Automatic Light Control (Apperation to 2 × 10-4 foot-candles. This can provide a 1000 hours according to the manufacturer's recommendatic control when using the SIT tube, life can be extended thermionic cathode emission will end its life, as in of Because of its excellent characteristics many military, applications, in addition to survaillance applications, low-light-level television cameras employing the SIT to QUALIFICATION JEST for Qualification Test Flow, see Table 2 located at the	ay target vidicon with an evels. Faceplate exposure (LE) function that restricts in SIT life of more than ons. By providing exposure to the point where reduced ther camera tobes. medical, and scientific have been developed for the.

FHEA NO		CR	SHUTTLE CCTV	UKIT <u>TVC/CLA</u> 0W6 NO. 2294819-506, 508/ 2294821-503 SHEET <u>6</u> OF <u>16</u>
FAILURE HODE AND CAUSE	FAILURE EFFECT ON END TIEN	RATIONALE FOR ACCEPTANCE		ANCE.
malfunction in the camera to cause tal loss of the active video sig- l or video information that will owide degraded performance. Com- site sync and vertical blanking gnals are useable and not affected. Command Decode Logic. Command Execution Logic. Hurizontal Deflection. Vertical Deflection. Vertical Alignment. Black/White Clippar. Gamma Correction. Shading Correction. Shading Correction. Video Output Driver. Automatic Light Control. Automatic Gain Control. Output Voltage Regulator. Input Voltage Regulator. Input Voltage Pre-Regulator. Primary Oscillator/ Oriver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) High Voltage Power Supply. Varget Preamplifier. Beam Current Regulator. Cathode Blanking. Shading Waveform Generator. 4 SII Tube	Loss of mission critical video	might be used in the Vibration: Thermal Vacuum: The IVC/CLA may not for Acceptance Test OPERATIONAL ISSI In order to verify health of all the through the RCU, the decoder. The test ability to route would be performed Pre-Lauruch on 1. Power CCI 2. Via the following the performed 4. Select #6. Observe waynchroni is received synchroni is received the months of the	t must also verify the camera's a rideo, and the monitor's ability it to verify the MOM command path. I <u>Grbiter Test/In-Flight Test</u> IV System, PHS panel, select a monitor as de source. pera Power On" command from PHS p external Sync" on monitor. rideo displayed on monitor. Mote ized fi.e., stable raster; then to riag composite sync from the RCU ized video.	rom 0.01 G ² /Hz inpe its the temperature shall be as ment plus ! hour ment plus ! h

FHEA NO		SHUTTLE CCTV CRITICAL ITEMS LIST	UNIT <u>FVC/CLA</u> DHG NO. 2294819-506, 508/ 2294821-503 SHEET 7 OF 10.
TATLURE MODE AND FAILURE EFFECT ON END ITEM		RATIONALE FOR ACCEPTANCE	
malfunction in the camera to cause tal loss of the active video sig- l or video information that will ovide degraded performance. Com- site sync and vertical blanking gnals are useable and not affected. Command Decode Logic. Command Execution Logic. Camera Timing Logic. Horizontal Deflection. Vertical Beflection. Vertical Beflection. Vertical Alignment. Black/White Clipper. Gamma Correction. Shading Correction. Shading Correction. Video Dutput Driver. Automatic Light Control. Automatic Gain Control. Dark Current Compensation. Dutput Voltage Regulator. Input Voltage Regulator. Input Voltage Pre-Regulator. Primary Oscillator/ Uriver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) High Voltage Power Supply. Target Preamplifier. Useam Current Regulator. Cathode Blanking. Shading Maveform Generator. 14 Sil Tube	Loss of mission critical video	Procurement Centrol - The TVC/CLA EEE Parts and hardware approved venders and suppliers, which meet the requirement rentract and Quality Plan Hork Statement [NS-2593176]. review all procurement documents to establish the meed (PAI 517). Incoming Inspection and Storage - Incoming Quality inspection materials and parts. Results are recorded by drawing and control numbers for future reference and trace subjected to incoming acceptance tests as called for inspection Test Instructions. Incoming Flight parts are accordance with RCA 1846684 - Preconditioning and Accepted note Parts, with the exception that DPA and PIND Hechanical items are inspected per PAI 316 - Incoming I mechanical items, PAI 386 - Incoming Quality Coatrol In PAI 612 - Procedure for Processing Incoming or Purchase Use. Accepted items are delivered to Material Controll under specified conditions until fabrication is require held for Material Review Board [HR8] disposition. (PAI Board Assembly & Test - Prior to the start of IVC or Clare verified to be correct by stock room personnel, as form a kit. The items are verified again by the operathecking against the as-built-parts-llst (A8PL). OCAS are designated for all printed circuit, wire wrap and wharness connectors for soldering wiring, crimping, sold wurkmanship prior to coating of the component side at harnesses. TVC Boards Specific TVC board assembly and test instructions are applicable documents are called out in the Fabrication (FPR-2294819) and parts list PL294819. These include 12593660, Process Standard RTV-566 2260881, Pro	Resident DCAS personnel for 651 on selected parts actions are made on all lot and retained in file by accability. All EEE parts in PAI 315 - Lacoming the further processed in stance Requirements for testing is not performed. Aspection Instruction, and appection Instruction, and appection Instruction, and appection Instruction, and aspection appears the items are accumulated to the items are accumulated

TVC/CLA DWG NO. 2294819-5**06, 50**8/ SHUTTLE CCTV FMEA NO. 2.2.2 2294821-503 CRITICAL ITEMS LEST 9 OF <u>18</u> CRITICALITY 2/2 FAILURE EFFECT FAILURE MODE AND RATIONALE FOR ACCEPTANCE ON END LIEH. CAUSE FAILURE HISTORY (1) Unable to open lens malfunction in the camera to cause stal loss of the active video sigtris. TOR - W2575 - Log #0400 - TVC S/N 005-501 (2) Degradation of picor video information that will ture content. ovide degraded performance. Com-Description: Acceptance Test Failure isite synt and vertical blanking Box Level ignals are useable and not affected. Worst Case: Vibration Environment Loss of mission. Video presentation rotated approximately 6° after vibration. critical video. Commana Decode Logic. Gause: Vidicon Yoke nut became loose during vibration. Command Execution Logic. Camera Jimiag Logic. Corrective Action: Reposition yoke, tighten nut and add staking to sensor assy's 3 Horizontal Deflection. yoke nut. ECN (81073) Issued. Vartical Dailection. Focus Current, Horizontal Align-TOR - W2576 -Log #0412 - TVC S/N 005-501 ment. Vertical Allgament. | Black/White Clipper. <u>Description</u>: Acceptance Test failure Garma Correction. Box Level Aperture Correction. Vibration Environment Shading Correction. CM rotation of picture after "Y axis vibration. (Retest of TVC per TOR W2575.) Video Öutput Oriver. 5 Automatic Light Control. Cause: Bonding of yoke (At) broke loose allowing yoke to rotate during Automatic Gain Costrol. vibration. Dark Current Compensation. 6 Output Yoltage Regulator. Corrective Action: Assembly procedure revised per ECN CCT 600 (81073) to provide for Input Voltage Pre-Hagulator. better staking of yoke. 7 Primary Oscillator/ Driver (sync loss) TOR - W2560 - Log #0414 - TVC \$/N 006-501 Secondary Rectifiers/ Filters (change of voltage or loss of <u>Description</u>: Acceptance Test Failure filtering Bow Level 8 High Voltage Power Supply. Vibration Environment § Target Preamplifier. Input current increased by 186 mA from normal input current during vibration is 10 Beam Current Regulator. "Y" Axis. Cathode Blanking. 12 Shading Naveform Generator. Cause: Defective capacitor C26 on A3 board. Analysis indicated manufacturing 14 SET Tube defect - capacitive element was loose inside metal case. Corrective Action: Remove and replace part. Retested camera per PMD directive. Capacitors removed from stock and returned to vendor. Reference memo CCTV-(C)-243 for close out of TOR W2560.

__IVC/CLA UNIT <u> 2294819-506, 508/</u> DHG NO. SHUTTLE CCTV FHEA NO. 2.2.2 2294821-503 CRITICAL ITEMS LIST CRITICALITY __2/2 FAILURE EFFECT FAILURE HODE AND RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE FAILURE HISTORY (Continued) (1) Unable to open lens valfunction in the camera to cause al loss of the active video sigiris. TDR - W0988 - Log #0432 - TVC S/N 005-501 12) Degradation of picor video information that will W0989 - Log #0428 - TVC S/N 005-501 ture content. wide degraded performance. Comite sync and vertical blanking Description: Acceptance Test Failure inals are useable and not affected. Worst Case: Box Level Loss of mission **1/V Hot Environment** Cluster of white spots in lower left quadrant of display on black field. Crazing critical videa. Command Decode Logic, of cement securing cover plass to fiberoptics faceplate evident. Command Execution Logic. Cause: Stresses exerted by potting naterial during temp. extremes resulted in Camera Timing Logic. Horizontal Deflection. de-lamination of the cover glass to SIT tube bonding. Vertical Deflection. Focus Corrent. Harizontal Align-Corrective Action: Hodified potting fixtues and technique used on SIT tube ment. Vertical Alignment. Dag. #2295530 modified by ECN (8 2082). SIT tubes returned to manufacturer for Black/White Clipper. rework of encapsulation. Vendor to perform temp tests on tube prior to shipment to insure cover glass does not shift. REF CCTV Directives CCTV - [D] - 054, Samua Correction. Aperture Carrection. $CCTV = \{0\} = 070$. Shading Correction. Video Õutput Driver. Automatic Light Control. TOR - M2739 - Log #0485 TVC S/N 009-502 Automatic Gain Control. Dark Current Compensation. Description: Pre-Launch failure Dutout Voltage Regulator. Box Level Test Japut Voltage Pre-Regulator. Ambigat Environment Primary Oscillator/ Problem report VSCS-201-6093 visual imspection of unit at KSC revealed a Oriver (sync loss) recessed pin 31 in the J1 connector. Secondary Rectifiers/ Filters (Lacation code function pin) ichange of voltage or loss of filtering) High Voltage Power Supply. Cause: Error in manufacturing of the connector pin. It is 0.035" shorter in Target Preamplifier. length than other pins is connector. I Heam Current Regulator. Cathode Blanking. Corrective Action: Remove and replace pin 31 in J1 connector. Test pins ability 2 Shading Waveform Generator. to lack into making connector. Perform contact retention test to insure pin 4 \$11 Tube is locking as required. Inspect to insure pin is not pushed out of place. IDR - W0401 - Eng #U499 - IVC 013-502 TDR - W4278 - Log #0497 - TVC 013-502 Description: Qualification Test Failure Box Level (Qual. Model) Ambient Environment Dulput video intermittent. Cause: SII has low 64 current.

TVC/CLA 2294819-506, 50B/ DWG NO. SHUTTLE CCTV FHEA ND. 2.2.2 2294821-503 CRITICAL ITEMS LIST 9B ÓF 10 SHEET CRITICALLTY 2/2 FAILURE EFFECT FAILURE MODE AND RATIONALE FOR ACCEPTANCE ON ENO 1TEM CAUSE FAILURE HISTORY (Continued) (1) Unable to open lens malfunction in the camera to cause tal loss of the active video sigtris. (2) Degradation of pic-) or video information that will Corrective Action: Remove and replace SIT. Defective tube returned to tura content. ovide degraded performance. Com-Lancaster for evaluation, Results: Tube failure verified. site sync and vertical blanking TDR - W4312 - Log #0506 - TVC S/N 014-502 quals are useable and not affected. Worst Ease: Lass of mission Description: Acceptance Test failure critical video. Box Level Command Decade Logic. Thermal Vac-Hot Environment Command Execution Logic. Approx. 45 minutes into (T/V Hot) soak at +125 $^{\circ}$ f video became distorted and TVC Camera Timing Logic. Horizontal Deflection. input current increased 710 mA to 800 mA. Vertical Deflection. Cause: Yoke definction coil devaloped a short between horizontal and vertical Focus Current, Horizomtal Aligndeflection windings at 50°C. The short was eliminated when the temperature ment. Vertical Alignment. was reduced. Black/White Clipper. Gamma Correction. Corrective Action: Replaced defective yoke with new part. This is a random Aperture Correction. failure. Shading Correction. Video Öutput Driver. TDR - W4677 - Log #0529 - TVC \$/N 009-502 Automatic Light Control. Automatic Gain Control. Description: Integration Test Failure Dark Current Compensation. Box Tevel 1 Output Vultage Regulator. Ambient Environment Input Voltage Pre-Regulater. | Primary Oscillator/ Center resolution measured 30% @ 300 TVL, should be 70% min. Amplitude appears appears to be intermittent. Driver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of Cause: Transformer 13 on the A7 Board had unusual interwinding capacity. causing ringing on the secondary resulting in a slightly higher nutput voltage. filteringl High Voltage Power Supply. <u>Corrective Action</u>: Interwinding capacity is not a parameter specified, nor can it larget Preamplifier. be measured readily. Transmitter 13 removed & replaced. Acceptance Test screening 10 Beam Current Regulator. will detect this problem if prosent on other units — This problem is considered a Cathode Blanking. 12 Shading Waveform Generator. random failure. 14 SIT Tube TDR - Y1781 - Lag #0577, TVC \$/N 017-504 Description: Acceptance lest Failure Bax Level Ambient Environment Oscillations in video output. Cause: Poor grounding in pre-amp. .

FMEA NO2.2.2		SHUTTLE CCTV CRETICAL RIEMS LIST	UNIT TYC/CLA DNG NO. 2294819-506, 508/ 2294821-503 SHEET 9C OF 10
FAILURE NODE AND CAUSE	FAILURE EFFECT ON END ITEM	RATIONALE FOR ACCEPTANCE	
nalfunction in the camera to cause alloss of the active video signor video information that will wide degraded performance. Compaite sync and vertical blanking mais are usuable and not affected.	(1) Unable to open less fris. (2) Degradation of picture content. Norst Case: Loss of mission critical video.	FAILURE HISTORY (Continued) Carrective Action: Unit reworked to ECN CCT 8 TDR - W1729 - Lag #8578 - TVC S/N 020-502 TDR - W1730 - Lag #0579 - WLA S/N 006-501 TDR - Y1404 - Lug #0565 - TVC S/N 011-502	30 for ground problem.
Command Decode Logic. Command Execution togic. Camera Timing Logic. Horizontal Deflection. Vertical Deflection. Focus Current. Horizontal Alignment. Vertical Alignment. Black/White Clipper. Gamma Correction. Aperture Correction. Shading Correction. Shading Correction. Video Output Briver. Automatic Light Control. Automatic Gain Control. Dark Current Compensation. Output Voltage Regulator. Input Voltage Pro-Regulator. Primary Oscillator/ Driver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) High Voltage Power Supply. Target Preamplifier. Beam Current Regulator. Cathode Blanking. Shading Maveform Generator. 4 SIT Tube		Observation: Flight failure Spacecraft Level TVC S/N 020, WLA S/N 006-STS-3 TVC S/N 011 - STS-2 Coherent noise in output video presentation. Cause: Poor conductive path to ground caused be oxidation of aluminum spacers. Corrective Action: Removed excessive conformal treated with alodine. Flow progress report has assembly of units. IDH - V6906 - Log #0630 - TVC S/N 019-504 Obscription: Flight failure STS-5 Problem report VJCS-024 Intermittent Pan/Tilt reset command. Couse: Problem could not be verified thru exte Corrective Action: Unit updated from group 504 Instructed test director to carefully monitor a retesting, failure still could not be verified. 10R - W6859 - Log #0695 - TVC S/N 024-506 Description: Pre-Launch Test failure Box Level Ambient Environment Automatic Iris goes from open to close. Cause: Problem could not be duplicated after e Corrective Action: None - unit returned to KSC	coating. Spacers were cleaned and been modified to imsure proper nsive thermal testing. to group 506 configuration. peration of this camera during

TVC/CLA IMET 2294819-506, 506/ 2294821-503 DWG NO. SHUTTLE CCTV FHEA NO. ________ CRITICAL LIENS LIST <u>9D_____0f___10__</u> SHEET CRITICALITY 2/2 **FAILURE EFFECT** FATLURE HODE AND RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE. FAILURE HISTORY (Continued) (1) Uaable to open lans malfunction in the camera to cause ial loss of the active video sigiris. (2) Degradation of picor vides information that will TOR - 41735 - Log #0723 - TVC 5/N N/A -506 ture content. wide degraded performance. Comite sync and vertical blanking <u>Description</u>: Acceptance Test Failure Morst Case: anals are useable and not affected. Box level Loss of mission Ambient Environment High voltage power supply S/M 2046 exhibits intermal arcing. This TDR was critical video. Command Decode Logic. opened to investigate failure noted on TDR-W6870, Log #722. Command Execution Logic. Cause: Improper lead dress of high voltage terminal. Camera Timing Logic. Horizontal Deflection. Corrective Action: HVPS 5/N 2046 was one of eight units manufactured under Vertical Deflection. purchse order G-T50999-4)5)-00F2B by Murata Erie. This problem is limited to focus Current, Harizontal Alignunits manufactured in 1982. All defective units have been screened and returned ment. Vertical Alignment. to Murata Erie for analysis and replacement. Black/White Clipper. Gamma Correction. Aperture Correction. TDR - H6870 - Lag #0722 - TVC \$/N 028-506 Shading Correction. Description: Acceptance Test Failure Video Gutput Driver. Ambient Environment Automatic Light Control. Box Level Test Automatic Gain Control. Approximately 47 seconds after initial turn on, the iris close command would be Dark Current Compensation. Output Voltage Regulator. generated by TVC. Input Voltage Pre-Regulator. Cause: Internal short in the high voltage power supply (S/N 2046), which Primary Oscillator/ Oriver (sync loss) generated spikes on the POR Line. Secondary Rectifiers/ Filters Corrective Action: H.V.P.S. removed from TVC and new H.V.P.S. installed. (change of voltage or loss of Tests indicated problem solved. Power supply returned to vendor for Evaluation. filtering) High Voltage Power Supply. Reter to TDR W1735, Log #723. The problem was attributed to improper lead dress of high voltage terminal. Target Preamplifier. These leads have been rerouted and extra insulation added at the HV terminal O Beam Current Regulator. Cathode Blanking. for all new built units. 2 Shading Waveform Generator. 4 51% Tube TOR - N-6875 - Log #0746 TYC \$/N 014-506 TOR - H-6872 - Log #0742 TVC S/N 011-506 Cause: Resistor R6 on A10 hoard, failed. <u>Forrective Action</u>: All flight cameras containing R6 resistor fabricated by ACI and dated with code 7813 will be replaced with new ANC60 type resistors from TRM.

91123 A D

TYC/CLA UNIT 2294819-506, 508/ DMG NO. SHUTTLE CCTY 2294821-503 CRIFICAL ITEMS LIST CRITICALITY 2/2 FATLURE EFFECT FAILURE MODE AND RATIONALE FOR ACCEPTANCE METT DAY HO CAUSE FACLURE HISTORY (Continued) (1) Unable to open lens nalfunction in the camera to cause tal loss of the active video sigiris. TDR - W6917 - Log #0748 - TVC \$/N 838-506 (2) Degradation of pic-) or video information that will ture coatent. ovide degraded performance. Com-<u>Description</u>: Acceptance Test Failure site sync and vertical blanking Worst Case: Bus Level quals are useable and not affected. Ambiest Environment Lass of mission Video presentation very noisy whea 34 cable is connected. critical video. Command Decode Logic. Cause: Sensor assembly clamp sleeve shorted to chassis. Insufficient insulation Command Execution Logic. coating on clasp sleave. Camera Timing Logic. Horizontal Deflection. Corrective Action: New clamps were installed. All parts in controlled stores were Vertical Deflection. inspected and all discrepant materal rejected. Focus Current. Horizontal Alignment. Vertical Aligament. TDR - W6925 - Log #0770 - TVC S/N 022-506 Black/Mhite Clipper. Gamma Correction. Description: Flight failure (STS-8) Aperture Correction. Spacecraft Lavel Shading Correction. Video Öutput Oriver. Horizontal streaking in picture gamma when in black stretch. Automatic Light Cuntrol. Automatic Gain Control. Cause: Incorrect shim installed. Face plate shim shorted to ground. Dark Current Compensation. Output Voltage Regulator. Corrective Action: Shim removed and correct shim installed per ECN-CCT859. All Input Voltage Pre-Regulator. future TVC's will conform to this ECN. Primary Oscillator/ Driver (sync loss) TDR - A3249 - Log #0929 - TVC S/N 033-506 Secondary Ructifiers/ Filters (change of voltage or loss of <u>Description</u>: Acceptance Test Failure filtaringl Box Level High Voltage Power Supply. Thermal Vac. Ambient Environment Target Preamplifier. Video locked im white clip mode. O Beam Current Regulator. Cathode Blanking. Cause: Defective Transistor Q16 on A5 Board. 12 Shading Waveform Generator. 4 SIT Fube Corrective Action: Removed Q16 and replaced with new transistor. Q16 X-rayed and a dense particle was observed. Further analysis proved to be a loose and metallic particle. Considered to be random failure. TDR - A4093 - Log #0973 TVC S/N 019-506 <u>Description</u>: Acceptance Test Failure 8ax Level Vibration Environment Unit failed "Y" axis vibration, picture on monitor all white.

FMEA NO		SHUTTLE CCTV CRITICAL ITEMS LIST	UNIT TYC/CLA DING NO. 2294819-506, 508/ 2294821-503 SHEET 9F OF 16
TAILURE MODE AND CAUSE ma)function in the camera to cause tal loss of the active video sign or video information that will ovide degraded performance. Committee sync and vertical blanking gnals are useable and not affected. Command Decode Logic. Command Execution Logic. Command Execution Logic. Command Execution Logic. Vertical Deflection. Focus Current. Horizontal Alignment. Vertical Alignment. Black/Mhite Clipper. Gamma Correction. Aperture Correction. Shading Correction. Video Output Briver. Automatic Light Control. Automatic Gain Control. Output Voltage Regulator. Input Voltage Regulator. Primary Oscillator/ Driver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) High Voltage Power Supply. Target Preamplifier. Mean Current Reyulator. Cathode Blanking. Shading Waveform Generator.	FAILURE EFFECT ON END ITEM (1) Unable to open lens iris. (2) Degradation of picture content. Horst Case: toss of mission critical video.	FAILURE HISTORY (Continued) Cause: Defective Q7 on the A4 board. Corrective Action: Product Assurance analysi found an entraneous gold bond wire positioned base leads of the dual transistors. Transist code, plus all transistors with different dat were found. Concluded that this was a random IOR - W1746 - Log #1024, TVC S/N 011-506 Description: Pre-Launch Test Failure Box Level Ambient Environment KSC DR.3C430012 ALC and Gamma controls intermittent. Pan and Cause: Intermittent operation of ALC and Gam thru extensive thermal testing. Intermittent of right hand camera slide. Corrective Action: Slides were re-positioned problem solved. Returned TVC 011 to "JSC" for further evaluat TDR - 80146 - Log #1079 - TVC S/N 007-506 Description: Flight Failure Flight #41D Evaluation Test TVC returned from KSC for evaluation of white orbiter flight #410. Cause: Arcing in vicinity of ground tab of (Carrective Action: Removed tube S/N J0249 fr Log #1105 to track tube; tube returned to ven Installed new tube into sensor. IDR - 8-0148 - Log #1085 - TVC S/N 044-506 Description: Acceptance Test Failure United video seen on monitor. Distortion modulated and random. Distorted video seen on monitor. Distortion modulated and random.	s revealed an open transistor Q7. They so as to cause a short between the ers with the same date a codes were X-rayed and no anomalies failure. tilt operation intermittent. Ma commands could not be duplicated tilt motion due to improper position per ECN-CCT 1178. Retest indicated ion of ALC/GANMA analmoly. streaks in video observed during ace plate of SII tube S/N J8294. com sensor assembly, opened TOR-80809, whor.

UNET TYC/CLA 2294819-506. 508/ DWG NO. SHUTTLE CCTV FMEA NO. 2.2.2 2294821-503 CRITICAL ITEMS LIST SHEET 96 OF 10 CRETICALITY 2/2 FAILURE EFFECT FATLURE HODE AND RATIONALE FOR ACCEPTANCE ON END ITEM. CAUSE FAILURE HISTORY (Continued) (1) Unable to open lens malfunction in the camera to cause irks. tal loss of the active video sig-Cause: Random noise is caused by poor grounding of the A9 pre-amp. Modulated (2) Degradation of pic-I or video information that will noise is due to A5 board operation. ture content. ovide depraded parformance. Comsite sync and vertical blanking <u>Corrective Action</u>: Random make problem was cured by cleaning the A9 ground gnals are useable and not affected. Morst Case: connections and the incorporation of ECM D09485 - redundant wire ground commection Loss of aission to the A9 pre-amp. Modulated moise problem was cured by incorporating ECM critical videa. E1773 to the A5 board which lights the control voltage to the A8 high voltage Command Dacade Logic. power supply. TVC Group number was changed from 2294819-506 to 2294819-508. Command Execution Logic. Camera Timing Logic. TOR - 8-2352 - Log # 1123 TVC S/N 433-506 Horizontal Deflection. Vertical Deflection. <u>Pescription</u>: Pre-Launch Tast Failure facus Current. Harizontal Align-Box Leval ment. Vertical Alignment. Amblent Environment. Black/Hhite Clipper. (Ref) 3CA420062) Noisy video, vertical lines with low light level. Gamma Correction. Aperture Correction. Cause: Poor A9 pre-amplifier ground. Shading Correction. Video Butput Driver. Corrective Action: ECN CCT 1237. Written to add redundant ground lead. Automatic Light Control. Automatic Gain Control. 1DR - 83451 - Lag #1150 S/N 042-508 Dark Current Compensation. Butput Voltage Regulator. Description: Acceptance Test Failure Input Voltage Pre-Regulator. Box Level Primary Oscillator/ Vibration Environment Driver (sunc loss) Vertical doise pattera present in video. Secondary Rectifiers/ Filters (change of voltage or loss of Cause: Poor ground connection on A9 pre-amplifier board thru conductive washers. filtering) High Voltage Power Supply. Corrective Action: ECN 0-9584 (Ground wire installation) was installed in sensor Target Preamplifier. assembly. This ECN incorporated in all previous units presently located at RCA, O Bean Current Regulator. and all new build units. Cathode Blanking. 12 Shading Maveform Generator. TOR - 83518 - Log #1174 - TVC S/N 020-506 4 S[T Tube Description: Pre-Launch Test Failure Bax Level Ambient Environment Problem report #DR.3C53001A Evaluate video noise problem Cause: Poor grounding for pre-amp. TVC depended on a mechanical ground connection.

TYC/CLA 2294819-506, 508/ DNG NO. SHUTTLE CCTV FMEA HO. 2.2.2 2294821-503 CRITECAL ETENS LIST SHEET 9H OF 10 CRITICALITY _2/2 ______ FACLURE EFFECT FAILURE HODE AND RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE FAILURE HISTORY (Continued) (1) Unable to open leas nalfunction in the camera to cause tal loss of the active widen sigiris. Corrective Action: ECN CCT-1237 was prepared adding redundant hard wire ground. (2) Degradation of picl or video information that will This ECH was incorporated into TVC 5/N 020 and retast indicated problem resolved. pyide degraded performance. Comture contest. This ECN will be incorporated into all TVC's in process. site sync and vertical blanking quals are usuable and not affected. Worst Case: TOR - C0751 - Log #2002 - TVC 5/N 024-508 Loss of mission TOR - A3105 - Log #2097 - TVC S/6 024-508 critical video. Command Decode Logic. Description: Acceptance Test Failure Command Execution Lugic. Box Level Camera Timing Logic. Horizontal Deflection. Ambient Environment White ion spot visable in center of raster. Tube conditioning procedure operated Vertical Deflection. in excess of 60 Hrs. which, reduced spot size to 20-25 IRE. Usit authorized to Focus Current. Horizontal Alignship to NASA/JSC for further evaluation. The above unit returned from MASA (Ref. ment. Vertical Alignment. PR-DR 3C530032) with the 26-25 IRE sent. | Black/White Clipper. Gamma Correction. Cause: TVC tube operated in an unathorized configuration or mode such as Aperture Correction. (1) extended exposure to bright light (2) loss of camera voltages. (3) exposed Shading Correction. to light without leas assembly. Video Öutput Driver. Automatic Light Control. Corrective Action: SIT replaced with new tube. Old tube sent to RCA-Lancaster Automatic Gain Control. for analysis. Found silicon target burned. No corrective action possible on Dark Current Compensation. tube S/N Z43686. Tube to be labeled as non-flight, but way be used in non-critical 5 Output Voltage Regulator. application such as for IVC trainer. Input Voltage Pre-Regulator. ¿ Primary Oscillator/ TDR - C4523 - Log #2039 - TVC 044-508 Driver (sync loss) Secondary Rectifiers/ Filters <u>Description</u>: Evaluation Test (change of voltage or loss of Box tavel filterinal Ambient Environment High Valtage Power Supply. B High Voltage Power St 9 Target Preamplifier. Output of high voltage power supply OV with 6.0 Yes control voltage, should be approximately 9 ky intermittent operation, slight rap on housing will produce 9 kV. 10 Beam Current Regulator. Cathode Blanking. Cause: Analysis of failure under investigation. 12 Shading Waveform Generator. 14 SIT lube Corrective Action: N/A IDR - C0693 - Log #2042 - TVC S/N 042-508 Qescription: Flight Failure STS 51F (26). Spacecraft Level String like material on lens or TVC noticed in video presentation, also horizontal goise is present in autput video.

			XEVISED 5-7-87
FMEA NO2.2.2 CRITICALITY2/2		SHUTTLE CCTV CRITICAL TIEMS LIST	UNIT TVC/CLA DWG ND 2294819-506, 508/ 2294821-503 SHEET 91 OF 10
FAILURE MODE AND CAUSE malfunction is the camera to cause tal loss of the active video sigular or video information that will owide degraded performance. Consite sync and vertical blanking gnals are useable and not affected. Command Decode Logic. Command Execution Logic. Command Execution Logic. Command Execution. Vertical Deflection. Vertical Deflection. Focus Current. Horizontal Alignment. Black/White Clipper. Gamma Correction. Aperture Correction. Shading Correction. Video Output Driver. Automatic Cain Control. Dark Current Compensation. Output Voltage Regulator. Input Voltage Regulator. Primary Oscillator/ Driver (sync loss) Secondary Rectifiers/ filters (change of voltage or loss of filtering) High Voltage Power Supply. Target Preamplifier. Beam Current Regulator. Cathode Blanking. Shading Waveform Generator. SIT Tube	FAELURE EFFECT ON FHD JTEM (1) Unable to open lens iris. (2) Degradation of picture content. Worst Case: Loss of mission pritical video.	RATIONALE FOR ACCEPT FAILTRE HISTORY (Continued) Cause: String like material was found on face of determined where it came from. Horizontal noise of corrective Action: String removed with small be instance of such contamination. Horizontal noise he duplicated during 9 days of thermal cycling a probable cause of the video noise was external in the contamination.	of SIT tube and could not be a could not be a could not be duplicated. This is the first reported so in video as reported could not and thermal vacuum testing. The

FNEA NO. 2,2,2 CRETICALITY 2/2		SHUTTLE CCTV CRITECAL LIENS LIST	UNIT <u>TVC/CLA</u> DWG NO. <u>2294819-506. 508/</u> 2294821-503 SHEET <u>10</u> OF <u>10</u>
FAILURE HODE AND CAUSE nalfunction in the camera to cause otal loss of the active video signal or video information that will provide degraded performance. Committee sync and vertical blanking ignals are useable and not affected. VC Command Decode logic. Command Execution Logic. Command Execution Logic. Command Execution Logic. Camera Timing Logic. 3 Horizontal Deflection. Vertical Deflection. Vertical Alignment. Wellian Correction. Shading Correction. Shading Correction. Video Output Oriver. As Automatic Light Control. Automatic Sain Control. Aperture Current Compensation. Output Voltage Regulator. Input Voltage Pre-Regulator. Input Voltage Pre-Regulator. Al Primary Oscillator/ Briver (sync loss) Secondary Rectifiers/ Filters (change of voltage or loss of filtering) Al High Voltage Power Supply. Al Target Pre-Amplifier. All Bean Current Regulator. Cathode Blanking. All Shading Waveform Generator. Alf SIT Jube	FAILURE EFFECT OH END 1TEM (1) Unable to open lens ivis (2) Degradation of picture content. Horst Case: Loss of mission critical yideo.	OPERATIONAL EFFECTS Loss of video. Possible loss of major mission objection other required cameras. CREM ACTIONS If possible, continue RMS operations using alternative CREW THAINING Crew should be trained to use possible alternatives to MISSION CONSTRAINI Where possible, procedures should be designed so they CCTV.	ves due to loss of RHS cameras visual cues.